

















# SWITCH FUNCTION

NO. POLES	UL/CSA MODEL NO.	MODEL NO.	SWITCH FUNCTION			CONNECTED TERMINALS / SCHEMATIC					
			POS.1	POS.2	POS.3	POS.1	POS.2	POS.3			
SP	Q1111	1MS1	ON	NONE	ON		N/A				
	Q1112	1MS2	ON	NONE	MOM						
	Q1113	1MS3	ON	OFF	ON						
	Q1114	1MS4	MOM	OFF	MOM					OPEN	
	Q1115	1MS5	ON	OFF	MOM						
DP	Q1121	1MD1	ON	NONE	ON		N/A				
	Q1122	1MD2	ON	NONE	MOM						
	Q1123	1MD3	ON	OFF	ON						
	Q1124	1MD4	MOM	OFF	MOM					OPEN	
	Q1125	1MD5	ON	OFF	MOM						
	▲ Q1126	1MD6	ON	ON	ON						
	▲ Q1127	1MD7	MOM	ON	MOM				2-3,5-6	2-3,5-4	2-1,5-4
	▲ Q1128	1MD8	ON	ON	MOM						
3P	Q1131	1M31	ON	NONE	ON		N/A				
	Q1132	1M32	ON	NONE	MOM						
	Q1133	1M33	ON	OFF	ON						
	Q1134	1M34	MOM	OFF	MOM					OPEN	
	Q1135	1M35	ON	OFF	MOM						
4P	Q1141	1M41	ON	NONE	ON		N/A				
	Q1142	1M42	ON	NONE	MOM						
	Q1143	1M43	ON	OFF	ON						
	Q1144	1M44	MOM	OFF	MOM					OPEN	
	Q1145	1M45	ON	OFF	MOM						
	Q1146	1M46	ON	ON	ON						
	▲ Q1147	1M47	MOM	ON	MOM				2-3,5-6,8-9,11-12	2-3,5-4,8-9,11-10	2-1,5-4,8-7,11-10
	▲ Q1148	1M48	ON	ON	MOM						

MOM=MOMENTARY


▲ Please check the availability in advance before order

## 3-WAY SWITCHES

## 3-WAY WIRING DIAGRAM SCHEMATICS


SINGLE POLE, 3 POSITION

Model No.	POS 1	POS 2	POS 3
1MD6	ON	ON	ON
Term. Comm.	2-3,5-6	2-3,5-4	2-1,5-4

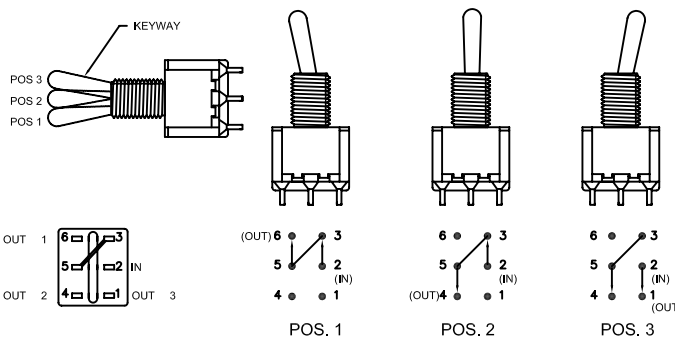


DOUBLE POLE, 3 POSITION

Model No.	POS 1	POS 2	POS 3
1M46	ON	ON	ON
Term. Comm.	2-3,5-6 8-9,11-12	2-3,5-4 8-9,11-10	2-1,5-4 8-7,11-10

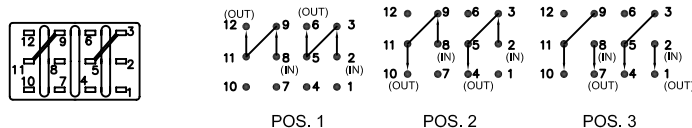


## POLE OPTIONS

### SPDT

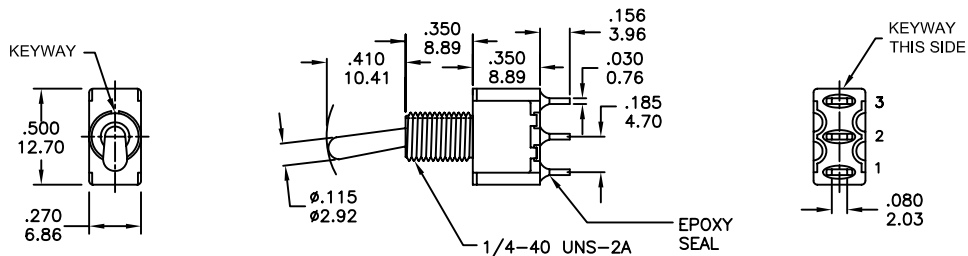



Part No. Shown : 1MS1T1B1M1QE

### DPDT

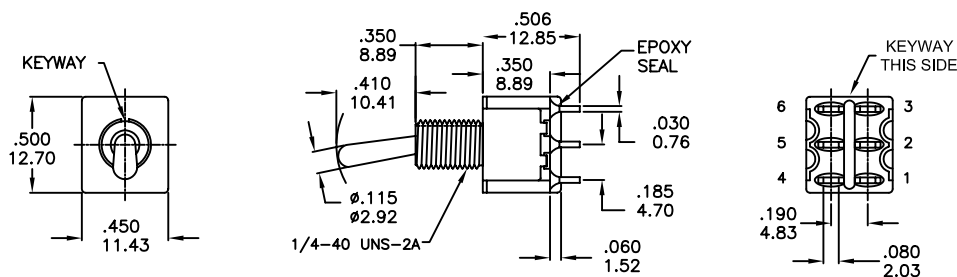



Part No. Shown : 1MD1T1B1M1QE

### 3PDT

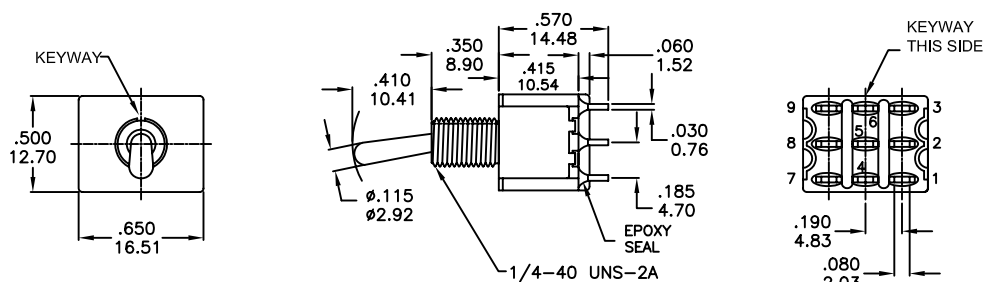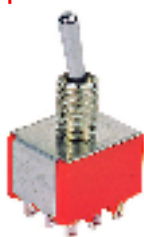

Part No. Shown : 1M31T1B1M1QE

### 4PDT

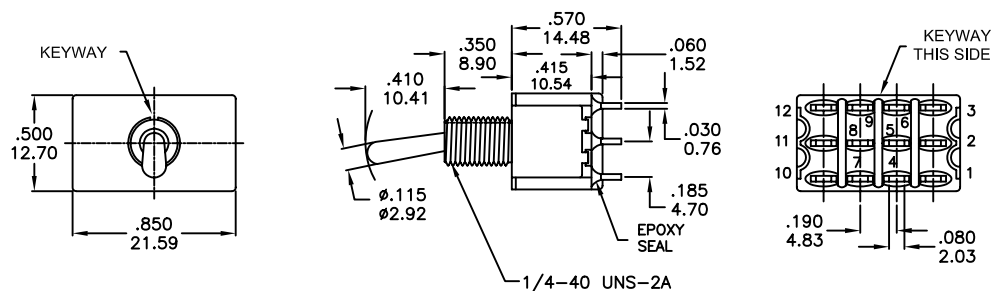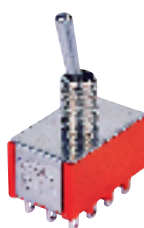

Part No. Shown : 1M41T1B1M1QE